

Model 137B21A

ICP® Pressure Sensor

Installation and Operating Manual

For assistance with the operation of this product, contact PCB Piezotronics, Inc.

Toll-free: 800-828-8840 24-hour SensorLine: 716-684-0001 Fax: 716-684-0987 E-mail: info@pcb.com Web: www.pcb.com







Repair and Maintenance

PCB guarantees Total Customer Satisfaction through its "Lifetime Warranty Plus" on all Platinum Stock Products sold by PCB and through its limited warranties on all other PCB Stock, Standard and Special products. Due to the sophisticated nature of our sensors and associated instrumentation, field servicing and repair is not recommended and, if attempted, will void the factory warranty.

Beyond routine calibration and battery replacements where applicable, our products require no user maintenance. Clean electrical connectors, housings, and mounting surfaces with solutions and techniques that will not harm the material of construction. Observe caution when using liquids near devices that are not hermetically sealed. Such devices should only be wiped with a dampened cloth—never saturated or submerged.

In the event that equipment becomes damaged or ceases to operate, our Application Engineers are here to support your troubleshooting efforts 24 hours a day, 7 days a week. Call or email with model and serial number as well as a brief description of the problem.

Calibration

Routine calibration of sensors and associated instrumentation is necessary to maintain measurement accuracy. We recommend calibrating on an annual basis, after exposure to any extreme environmental influence, or prior to any critical test.

PCB Piezotronics is an ISO-9001 certified company whose calibration services are accredited by A2LA to ISO/IEC 17025, with full traceability to SI through N.I.S.T. In addition to our standard calibration services, we also offer specialized tests, including: sensitivity at elevated or cryogenic temperatures, phase response, extended high or low frequency response, extended range, leak testing, hydrostatic pressure testing, and others. For more information, contact your local PCB Piezotronics distributor, sales representative, or factory customer service representative.

Returning Equipment

If factory repair is required, our representatives will provide you with a Return Material Authorization (RMA) number, which we use to reference any information you have already provided and expedite the repair process. This number should be clearly marked on the outside of all returned package(s) and on any packing list(s) accompanying the shipment.

Contact Information

PCB Piezotronics, Inc. 3425 Walden Ave. Depew, NY14043 USA Toll-free: (800) 828-8840 24-hour SensorLine: (716) 684-0001 General inquiries: <u>info@pcb.com</u> Repair inquiries: <u>rma@pcb.com</u>

For a complete list of distributors, global offices and sales representatives, visit our website, <u>www.pcb.com</u>.

Safety Considerations

This product is intended for use by qualified personnel who recognize shock hazards and are familiar with the precautions required to avoid injury. While our equipment is designed with user safety in mind, the protection provided by the equipment may be impaired if equipment is used in a manner not specified by this manual.

Discontinue use and contact our 24-Hour Sensorline if:

- Assistance is needed to safely operate equipment
- Damage is visible or suspected
- Equipment fails or malfunctions

For complete equipment ratings, refer to the enclosed specification sheet for your product.

Definition of Terms and Symbols

The following symbols may be used in this manual:



DANGER

Indicates an immediate hazardous situation, which, if not avoided, may result in death or serious injury.



CAUTION

Refers to hazards that could damage the instrument.



NOTE

Indicates tips, recommendations and important information. The notes simplify processes and contain additional information on particular operating steps.

The following symbols may be found on the equipment described in this manual:



This symbol on the unit indicates that high voltage may be present. Use standard safety precautions to avoid personal contact with this voltage.



This symbol on the unit indicates that the user should refer to the operating instructions located in the manual.



This symbol indicates safety, earth ground.



PCB工业监视和测量设备 - 中国RoHS2公布表 PCB Industrial Monitoring and Measuring Equipment - China RoHS 2 Disclosure Table

部件名称	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴 联苯 (PBB)	多溴二苯 醚 (PBDE)			
住房	0	0	0	0	0	0			
PCB板	Х	0	0	0	0	0			
电气连接 器	0	0	0	0	0	0			
压电晶 体	х	0	0	0	0	0			
环氧	0	0	0	0	0	0			
铁氟龙	0	0	0	0	0	0			
电子	0	0	0	0	0	0			
厚膜基板	0	0	Х	0	0	0			
电线	0	0	0	0	0	0			
电缆	Х	0	0	0	0	0			
塑料	0	0	0	0	0	0			
焊接	Х	0	0	0	0	0			
铜合金 /黄 铜	Х	0	0	0	0	0			
本表格依据 SJ/T 1	L 1364 的 规定	E编制。							
0:表示该有害物	勿质在该部件	所有均同	気材料中	的含量均在 GB/T 26	572 规定的限量要求以	下。			
				材料中的含量超出(3目前由于允许的豁	6B/T 26572 规定的限量 免。	要求。			

CHINA ROHS COMPLIANCE

Component Name	Hazardous Substances								
	Lead (Pb) Mercury (Hg)		Cadmium (Cd)	Chromium VI Compounds (Cr(VI))	Polybrominated Biphenyls (PBB)	Polybrominated Diphenyl Ethers (PBDE)			
Housing	0	0	0	0	0	0			
PCB Board	Х	0	0	0	0	0			
Electrical Connectors	0	0	0	0	0	0			
Piezoelectric Crystals	Х	0	0	0	0	0			
Ероху	0	0	0	0	0	0			
Teflon	0	0	0	0	0	0			
Electronics	0	0	0	0	0	0			
Thick Film Substrate	0	0	Х	0	0	0			
Wires	0	0	0	0	0	0			
Cables	Х	0	0	0	0	0			
Plastic	0	0	0	0	0	0			
Solder	Х	0	0	0	0	0			
Copper Alloy/Brass	Х	0	0	0	0	0			

This table is prepared in accordance with the provisions of SJ/T 11364.

O: Indicates that said hazardous substance contained in all of the homogeneous materials for this part is below the limit requirement of GB/T 26572.

X: Indicates that said hazardous substance contained in at least one of the homogeneous materials for this part is above the limit requirement of GB/T 26572.

Lead is present due to allowed exemption in Annex III or Annex IV of the European RoHS Directive 2011/65/EU.

OPERATION MANUAL FOR FREE FIELD BLAST PRESSURE PROBE Models 137B21X, B22X, B23X, B24X

1.0 INTRODUCTION

The Series 137B2XX Free Field Blast ICP[®] Pressure Probe is designed for measuring free field blast and shock tunnel pressure time profiles.

Designed with an ICP[®] built-in source follower amplifier, the 137B2XX Series offers sensitivities of 1, 20, 10 and 100 mV/psi with full-scale ranges from 0 to 50, 250, 500 or 5000 psi. The 137B2XX Series is constructed with a stable quartz piezoelectric element in an Invar housing

2.0 INSTALLATION

In field blast measurements, mount the Series 137B2XX pressure probe in an axial direction to the blast source. The probes should be elevated high enough off of the ground such that ground does not interfere with the measured pressure. See photo 1.



Photo 1

The sensing surface should be aligned in a vertical plane with respect to the ground as shown in photo 2. Avoiding direct exposure of the diaphragm to sunlight is good practice so that changing temperatures throughout a test day do not change the sensitivity of the sensor. In any case care must be taken such that the sensor's diaphragm is not oriented down to avoid ground reflections.

In some cases, where flash temperatures such as those generated by blasts and shock fronts are present, it may be necessary to thermally insulate the diaphragm to minimize signals generated by these effects.



Photo 2

Common black vinyl electrical tape has been found to be an effective thermal insulating material in many cases. One layer may be used across the end of diaphragm and adaptor. See photo 3.



Photo 3

A silicone rubber coating approximately 0.010 inch (0.25 mm) thick has also been proven effective in many applications. General Electric RTV type 106 is recommended (PCB Model 065A67). Apply the rubber coating to the surface of the diaphragm and allow it to cure in accordance with the manufacturer's instructions.

3.0 OPERATION

Using suitable cable, connect the sensor to one of PCB's Series 480, 481, 482, 483, or 484 signal conditioners or equivalent power supply. If using a PCB line power unit, the equipment will supply the 137B2XX with an adjustable 2 to 20 mA constant current at +22 to +30 VDC through a current-regulating circuit. If using a battery-operated unit, the constant current is 2 mA. See Guide G-0001 for powering and signal utilization information pertinent to all ICP[®] instrumentation.

OPERATION MANUAL FOR FREE FIELD BLAST PRESSURE PROBE Models 137B21X, B22X, B23X, B24X

Switch power on and observe reading of bias monitoring voltmeter on front panel of signal conditioner.

If indicator is in green section of indicator panel, the IC amplifier is producing proper bias (8 to 14 VDC), the cable connections are normal, and the system is ready to operate.

If the pointer moves into the red area of the fault monitor meter, output is zero and a short is indicated. The short could be located in amplifier cable connectors or power unit.

If the pointer moves into the yellow area of the fault monitor meter, an open circuit is indicated with full power supply voltage.

An open circuit could be the result of a faulty amplifier, an open cable or open connectors. Check to be sure connectors are properly mated. Some PCB power units feature fault LEDs in place of a fault meter. Instead of a pointer, the fault LED will light when an open or short circuit condition is present.

Allow the sensor to thermally stabilize for about one minute. A signal drift may occur when the cable is connected to the readout instrument. This drift occurs during charging of the coupling capacitor in the power unit. The signal will stabilize in several minutes. Proceed with measurements.

Most line-powered signal conditioners manufactured by PCB have an adjustable current feature allowing a choice of input currents from 2 to 20 mA. In general, for the lowest noise (best resolution), choose the lower current ranges.

In order to maintain a high frequency response of the system when driving long cables (to hundreds or thousands of feet), use a higher current, up to 20 mA maximum. Use of low-capacitance cable (i.e. RG 62/U) and impedance-matching variable resistors are suggested to improve long cable performance characteristics. See Guide G-0001 for a discussion on cable considerations.

3.1 POLARITY

The 137B2XX Series produces a positive-going output voltage for increasing pressure output.

4.0 LOW-FREQUENCY RESPONSE

Consult Section 7.0 in General Guide G-0001 for detailed explanation of low-frequency characteristics of $ICP^{
B}$ instrumentation.

5.0 CALIBRATION

Do not try to calibrate the Series 137B2XX statically. The Series 137B2XX is calibrated dynamically by PCB using a hydraulic pulse technique.

For best accuracy, use the calibration certificate supplied. Factory recalibration is available for a nominal charge.

6.0 MAINTENANCE

Although ICP[®] sensors have low-output impedance and are not usually affected by moisture, in extremely damp environments it may be well to protect cable connections with shrink tubing.

It is well to observe the following precautions in using the sensor:

1. Do not exceed specified maximum range.

2. Do not subject sensor to temperatures exceeding temperature shown on specification sheet.

3. Do not apply voltage to sensor without current-limiting diodes or other current protection.

4. Do not apply more than 20 mA of current to the sensor.

Field repair of the piezoelectric element or amplifier of the Series 137B2XX is not practicable. Thus, should a sensor in this series require servicing, refer to the warranty sheet.

CAUTIONARY NOTE: If sensors are left outside overnight, they should be coated with silicone oil and covered. The protective silicone oil or grease coating should also be applied when the sensors are operated in a humid or rainy environment.

®ICP is a registered trademark of PCB Piezotronics

Model Number 137B21A	ICP [®] PRESSURE SENSOR							Revision: B ECN #: 51260		
Performance	ENGLISH	SI			0	PTIONAL VERSIO				
Measurement Range(for ±1V output)	1 kpsi	6,895 kPa		Optional versions	have identical specific	cations and accessori	es as listed for the st	andard model ex		
Sensitivity(± 15 %)	1 mV/psi	.145 mV/kPa			where noted be	ow. More than one o	ption may be used.			
Maximum Pressure	5 kpsi	34,474 kPa								
Resolution	8.5 mpsi	.059 kPa	[1]							
Resonant Frequency	≥ 400 kHz	≥ 400 kHz	[']							
Rise Time(Incident)	≤ 6.5 µ sec	≤ 6.5 µ sec								
Non-Linearity	≤ 0.5 µ sec ≤ 1.0 % FS	≤ 0.5 µ sec ≤ 1.0 % FS	[2]							
Environmental	21.07015	2 1.0 /013	[2]							
emperature Range(Operating)	-100 to +275 °F	-73 to +135 ℃								
Emperature Coefficient of Sensitivity	≤ 0.05 %/°F	≤ 0.090 %/°C								
Electrical	20.0370/1	20.000 /0, C								
Discharge Time Constant(at room temp)	≥ 0.2 sec	≥ 0.2 sec								
Excitation Voltage	20 to 30 VDC	20 to 30 VDC								
Constant Current Excitation	2 to 20 mA	2 to 20 mA								
Dutput Impedance	≤ 100 Ohm	≤ 100 Ohm								
Output Bias Voltage	8 to 14 VDC	8 to 14 VDC								
Physical	0.00.000									
Sensing Geometry	Compression	Compression								
Sensing Element	Quartz	Quartz								
Housing Material	Aluminum	Aluminum								
Diaphragm	Invar	Invar								
Sealing	Epoxy	Epoxy								
Electrical Connector	10-32 Coaxial Jack	10-32 Coaxial Jack								
Weight	12.5 oz	354 gm	[1]							
					east-squares, straight aration of Conforman					
				SUPPLIED ACCESSORIES: Model 085A43 Connector Protector (1) Model PCS-1 Calibration of pressure sensors up to 15k psi (except Series 113B50)						
				Entered: LK	Engineer: RPF	Sales: RWM	Approved: RPF	Spec Number:		
				Date: 11/13/2020	Date: 11/13/2020	Date: 11/13/2020	Date: 11/13/2020	55315		
All specifications are at room temperature (In the interest of constant product improver CP [®] is a registered trademark of PCB Piezc	nent, we reserve the right to ch	ange specifications withou	ut notice.	3425 Walden Aver	PIEZOTRO	Fax: 716-0 3	6-684-0001 584-0987 o@pcb.com			

